
Installation Instructions - Shur-Trak II[™] Side Mount Electric Motor - Worm Drive P/N 1111957 Rev. K

STEP 1: STEP 3: Remove spring pin Slide electric motor shaft into head shaft bore. Fasten FRONT and crank arm from with cap screw (3) and lock nut (1). COVER head shaft. Store SPRING PIN crank arm on trailer. HEAD SHAFT U-JOINT & CABLE & CRANK PULLEY NOTE: Install motor on PASSENGER side only. Driver side is reserved for manual override crank arm. HEAD SHAFT ELECTRIC MOTOR SHAFT HEAD SHAFT BORE **STEP 2:** Loosely mount electric motor to side mount bracket. STEP 4: Fasten motor mount plate to cable guard. Fasten with Fasten with screws supplied with motor and washers. screws **D**, lock washers **D**, flat washers **G** and nuts **G**. 5/16" x 3/4" CAP SCREWS Replace hardware on front cap, engaging motor mount & FLAT WASHERS plate as shown. Tighten motor mount bolts. SIDE MOUNT BRACKET -SIDE MOUNT ADJUSTABLE DRIVE ELECTRIC BRACKET MOTOR G (D DURABUILT MOTOR **NOTE:** Mount gear box \cap lb as shown with motor up. **ELECTRIC MOTOR WIRING** SIDE MOUNT BRACKET -UNIVERSAL LANDING STEP 5: Mount solenoid in suitable location - ventilated area near battery is ideal. Run 6-ga. wire from motor to solenoid and NOTE: Ground system through switch only. Wires to motor from power supply to circuit breaker to solenoid as shown. reverse continuity. Run 14-ga. wire from solenoid to switch. Mount switch in an area convenient to operator, inside or outside cab. Mount with bracket or install directly into dash panels. ELECTRIC MOTOR 6-GA. WIRE SOLENOID COVER MOTOR **@**.... SWITCH JUMPER WIRE PROVIDED BATTERY SOLENOID **TIPS ON WIRING** MOUNTING BRACKET Pick up power at battery or terminal block. Use 6-ga. wire or 14-GA. WIRE larger when connecting to power supply and motor. ×- Do not place wire in areas where wire could be pinched or cut during operation. Be sure to loop extra wire at hinge area on dump bodies. MOUNT CIRCUIT BREAKER · If switch is running system backwards, reverse 14-ga. wire at BATTERY AS CLOSE AS POSSIBLE TO solenoid to reverse system operation. POWER SUPPLY Momentary contact must be held open or closed to operate system.

PO BOX 713
2309 SHUR-LOK STREET YANKTON, SOUTH DAKOTA 57078-0713 PH. 1-800-474-8756 FAX 605-665-0501

SHUR-CO[®] HELP LIN CALL: 1-866-748-743 www.shurco.con

Installation Instructions - Shur-Trak II[™] Side Mount Electric Motor - Worm Drive P/N 1111957 Rev. K - continued

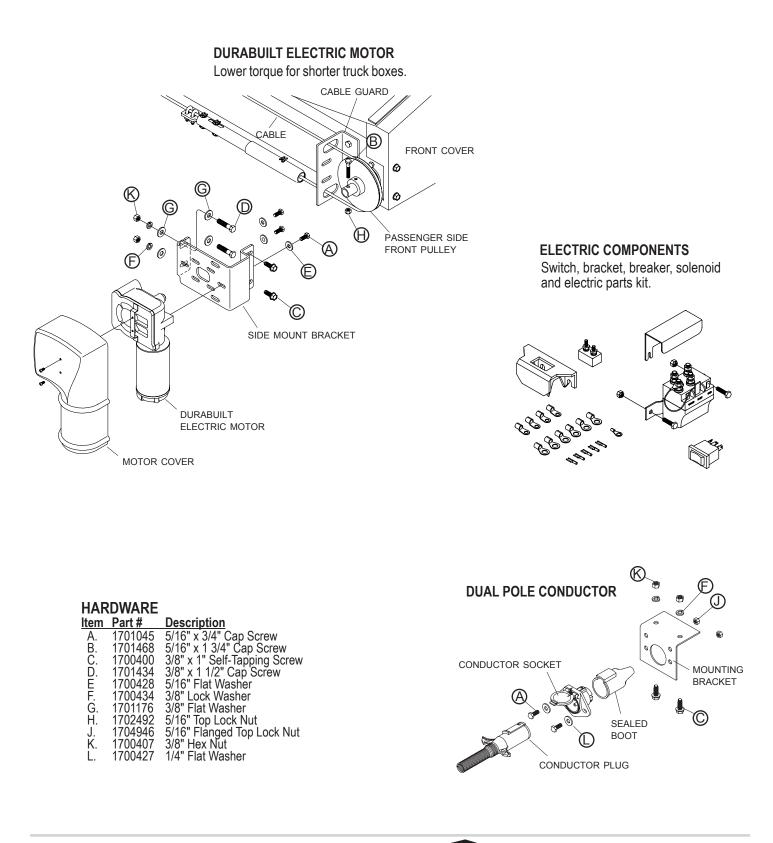

PO BOX 713 = 2309 SHUR-LOK STREET YANKTON, SOUTH DAKOTA 57078-0713 PH. 1-800-474-8756 = FAX 605-665-0501



SHUR-CO® HELP LIN CALL: 1-866-748-743 www.shurco.con